

INSPECTION / MAINTENANCE ACTION	PERIOD	Last C/W	Next Due	A/C HrsNow	Eng Hrs TS	Date C/W	Date Due	Remaining	ESC Now
DATA REF > Cabri G2 MM & ICA J70-002 - Issue 06				1,493.2	1,493.2	03 Apr 19			1460
			Hr Meter =>	1493.2					
Lycoming SB 480F Engine Oil Change (Full Flow Filter)	4 Months					16 Nov 18	16 Mar 19		
Cabri SB 19-003A Avionics Software							21 Jun 19		
W/C 32-A-02 Tail Rotor Gearbox Oil Drain & Flush	25	1093.9	Next Fit						
50 hr Inspection MP HW/G2/17	50	1443.7	1493.7					0.5	
Cabri MM C-22 Main Rotor Blades Insp - W/C 11-A-01	50	1443.7	1493.7	(In MP - Mandatory)				0.5	
Cabri MM C-22 Lead-Lag Dampers insp - W/C 14-A-02	50	1443.7	1493.7	(In MP - Mandatory)				0.5	
Lycoming SB366C Carb Throttle Body Screws Inspection	50	1443.7	1493.7	(In MP)				0.5	
100 hr / 12 Month Inspection MP HW/G2/17	100	1393.0	1493.0			22 Jun 18	21 Jun 19	-0.2	
Cabri MM C-22 Main Rotor Blades Insp - W/C 11-A-02	100	1393.0	1493.0	(In MP - Mandatory)				-0.2	
Cabri MM C-22 Spherical Bearings Insp - W/C 13-A-02	100	1393.0	1493.0	(In MP - Mandatory)				-0.2	
Cabri MM C-22 Tail Rotor Tension packs - W/C 31-B-02	100	1393.0	1493.0	(In MP - Mandatory)				-0.2	
Cabri MM C-22 Flexible Couplings Pack - W/C 33-A-06	100	1393.0	1493.0	(In MP - Mandatory)				-0.2	
Cabri MM C-22 Cooling Fan G52-00-02 - W/C 52-A-10	100	1393.0	1493.0					-0.2	
Tail Rotor Blades G31-05-102 Special Inspection	100	1393.0	1493.0	(Special Inspection for Guimbal)				-0.2	
Cabri MM D-2 Plasma Spark Plugs - Time in Service	200	1393.0	1593.0					99.8	
300 hr Engine Inspection MP HW/G2/17	330	1224.3	1554.3					61.1	
EASA-AD 2005-0023 Eng Exhaust Valves & Guides	330	1224.3	1554.3	(Lyc SB388C)	(In MP - Mandatory)			61.1	
Inspect Alternator Brushes for Wear (refer Kelly SIL A-1)	330	1224.3	1554.3					61.1	
500 hr / 60 Month Inspection MP HW/G2/17	500	994.0	1494.0			23 Aug 17	22 Aug 21	0.8	
Cabri MM C-22 Tail Rotor Tension packs - W/C 31-B-02	500	994.0	1494.0	(In MP - Mandatory)				0.8	
RG-25XC Battery Capacity Check (S/N 40921354)	12 Months				(New)	11 Feb 19	10 Feb 20		
Cabri MM B-5 Engine Mount Fittings Insp - W/C 64-A-1	15 Years						12 Feb 2031		
Cabri Service Mandatory & Recommended Bulletins to Comply With:									
SB 18-003A Governor Enhancement			1494.0				April 2019	0.8	
SB 18-008A Lead/Lag Damper			1493.0					-0.2	
SB 18-023B Mast Corrosion Protection			1494.0					0.8	
SB 18-025A TGB Attachment Bolts Threadlocking			1493.0					-0.2	
M.A. 305 (d) 1 Ads are in compliance to the following >									
			FAA-AD 2019-08		EASA-AD 8-2019				
Airworthiness Review Certificate expires							12 Feb 20	(2nd Year)	
MM D-3 0-360-J2A ENPL RT 10379 Engine Assembly	12 years				Refer Lycoming SI No 1009BD		13 Feb 28		
S/N L-42727-36E	2,000	0.0	2,000.0		Refer Lycoming SI No 1009BD, Table 2			506.8	

Maintenance Hold List/Observations	Date Enter	Hrs Enter	Required Action	Cleared Date / Hrs	M MEL Item
Exhaust Muffler - internal packing is insufficient	11 Jul 17	902.3	Replace no later than next 100 hr	23 Aug 17 994.0	NO
Fuel Flow Indications are Incorrect	23 Aug 17	944.0	Operator to advise & verify	10 Oct 17 1093.9	NO
R/H Eng Cowl Door-Fwd Lower Fire Shield Fretting (HG)	27 Jul 17	943.9	Replace no later than next 100 hr	23 Aug 17 994.0	NO
Main Rotor Pitch Links Contacting Swashplate Lower Ar	23 Aug 17	994.0	Refer Guimbal E-Mail dated 11 Oct 17 on	11 Oct 17 1093.9	NO
EGT Readings are unserviceable (<i>Intermittent</i>)	23 Aug 17	994.0	Waiting Replacement EGT Sensor	10 Oct 17 1093.9	NO
Pilot Tail Rotor Pedal Grip Tape Worn	16 Nov 17	1443.7	Next Maintenance Check		NO
Pilot Collective Grip Worn	16 Nov 17	1443.7	Next Maintenance Check		NO
P1 Cyclic Aft Trim intermittent operation	16 Nov 17	1443.7	Next Maintenance Check		NO
Rotor Brake Requires Adjustment	16 Nov 17	1443.7	Next Maintenance Check		NO

COMPONENT SUMMARY	Serial No	Life	Life at Fit	A/C Hrs Fit	Hrs Due	Date Due	TSN =	Rem to O/H	Rem Scrap
MM C-21 G52-02-200 or 201 Cooling Fan Front Flange (12 Sc)			Type is not fitted						
MM C-21 G51-20-206 Engine Pulley Ball Bearing (Asse)	No 943	2,200	2,200.0	0.0	2,200.0		1,493.2		706.8
SB 16-021C G52-04-100 Aluminium Cooling Fan (24-h)	(Fitted at build)	4,400	4,400.0	0.0	4,400.0		1,493.2		2,906.8
SB 16-021C G52-10-102 Engine Pully (24-hole)	(Fitted at build)			0.0					
MM D-2 G55-00-100 Fuel Blader	No 137	15 Years	15 Years			12 Feb 2031			
MM D-2 HG64-0971/0972/1428/1429 Seat Belts	L = 26/15 R = 26-1	12 Years	12 Years			13 Feb 2028			
MM D-3 G21-00-001 Main Rotor Gearbox Core	No 932	2,200	2,200.0	0.0	2,200.0			706.8	
MM D-3 G32-10-002 Tail Rotor Gearbox Core	No 950	2,200	2,200.0	1,033.5	3,233.5			1,740.3	
TCM SB643C Magneto 10-600644-201 (66B21779)	E15FA108	500	500.0	1,393.0	1,893.0	June 2022	(Overhaul)	399.8	(TCM SBs 643,658,663)
CABRI MM D-1 TIME IN SERVICE RECORDS									
MM D-1 G11-00-001 Main Rotor Blade	No 1192			0.0	(Overhauled @ 902.3)		1,493.2		
MM D-1 G11-00-001 Main Rotor Blade	No 1211			0.0			1,493.2		
MM D-1 G11-00-001 Main Rotor Blade	No 1213			0.0	(Overhauled @ 902.3)		1,493.2		
MM D-1 G12-00-101 Main Rotor Hub	No 930			0.0			1,493.2		
MM D-1 G13-00-100 Spherical Bearing	LK 0500			0.0			1,493.2		
MM D-1 G13-00-100 Spherical Bearing	LK 0516			0.0			1,493.2		
MM D-1 G13-00-100 Spherical Bearing	LK 0551			0.0			1,493.2		
MM D-1 G14-00-101 Lead-Lag Damper	LK 0683			0.0			1,493.2		
MM D-1 G14-00-101 Lead-Lag Damper	LK 0695			0.0			1,493.2		
MM D-1 G14-00-101 Lead-Lag Damper	LK 1078	(Green)		894.6			598.6		
MM D-1 G21-00-001 Main Gearbox	No 932			0.0			1,493.2		
MM D-1 G32-10-002 Tail Gearbox	No 950			1,033.5			459.7	(TSO)	
MM D-1 G33-10-000 Transmission Shaft Assembly	No 944			0.0			1,493.2		
MM D-1 G41-00-000 Swashplate Assembly	No 932			0.0			1,493.2		
MM D-1 G66-2069 Tail Totor Flexible Push-Pull Contro	No 145			0.0			1,493.2		
MM D-1 G55-00-100 Fuel Blader	No 137			0.0			1,493.2		
MM D-1 G61-23-103 Fuselage	No 87			0.0			1493.2		
MM D-1 G64-00-801 Engine Mount	No 936			0.0			1493.2		
MM D-1 G64-01-800 Engine Mount Struts (Qty 2)	No 1087 & 1088			0.0			1493.2		
MM D-1 G65-00-102 Tail Boom	No 942	(Repaired RSB17-503A)		0.0	(Repaired @ 902.3 hrs)		1493.2		
MM D-1 G65-05-102 Horizontal Stabilizer	No 945			0.0			1493.2		
MM D-1 G72-15-206 Electronic Pilot Monitor - EPM	No 1138			0.0			1493.2		
G31-05-102 Tail Rotor Blades (Titanium)	(Qty 7)	(Fitted October 2017)		1,093.9			399.3		